



SERVICE BULLETIN

SB No. 50 Issue No. 1

TITLE

INSPECTION OF PORT THROTTLE LIMIT STOP BOLTS

CLASSIFICATION

This Service Bulletin has been classified as Advisory

COMPLIANCE

Within 50 flight hours

APPLICABILITY:

T67B, T67C Series, T67M, T67M-MkII and T67M200.

INTRODUCTION:

An incident has occurred whereby one of the limit stop bolts on port throttle had vibrated to a new position and therefore had not allowed the throttle lever to move to the idle position.

ACTION:

Inspect both limit stops on port throttle for tightness and adjustment of the throttle setting. Finally, torque tighten to 6.5Nm (58lbin/5lbf).

Please note all bolts/socket head cap screws to be torque tightened in accordance with relevant T67 Maintenance Manual.

ISSUED
21 APR 1994

ISSUED BY:

B. Mellor

Date

29th March 1994

for and on behalf of **SLINGSBY AVIATION LIMITED**
Kirkbymoorside, York YO6 6EZ England

Tel 0751 32474 Telex 57597

Page

1

of

1